

Monitoring System

Resistance Thermometer Pt100

CPKN, CPKNO, CPKN-CHs
HPK, HPK-L
MegaCPK
RPH, RPH-HW

Supplementary Operating Manual



Legal information/Copyright

Supplementary Operating Manual Resistance Thermometer Pt100

Original operating manual

All rights reserved. The contents provided herein must neither be distributed, copied, reproduced, edited or processed for any other purpose, nor otherwise transmitted, published or made available to a third party without the manufacturer's express written consent.

Subject to technical modification without prior notice.

Contents

1	Supplementary Operating Manual	4
1.1	General	4
1.2	Technical data	4
1.3	Scope of supply	5
1.4	Function	5
1.5	Installing the PT100 resistance thermometer in the pump	5
1.6	Connections	6
1.7	Electrical connection	7

1 Supplementary Operating Manual

1.1 General

This supplementary operating manual accompanies the installation/operating manual. All information contained in the installation/operating manual must be observed.

Table 1: Relevant operating manuals

Type series	Reference number of the installation/operating manual
CPKN	2730.8, 2730.813, 2730.89
CPKN-CHs	2730.84
CPKNO	2730.88
HPK	1121.8, 1121.817
HPK-L	1136.8
MegaCPK	2731.8
RPH	1316.8014
RPHb, API 610	1321.8
RPHd	1322.81
RPH-HW	1327.8

1.2 Technical data

Table 2: Technical data (TR55)

Characteristic	Value
Sensor type	Pt100 resistance thermometer
Permissible measuring range (input signal)	-50 to +450 °C
Output signal	80 to 268 ohm
Head transmitter	None
Type	TR 55
Sensor tolerance	Class B to IEC 60751
Sealing, sensor tip/support tube	Not pressure-proof
Sensor tip	Spring-loaded (spring travel approx. 3 to 4 mm)
Wiring	1x4-wire
Process connection	G1/4 B (for RPH: G1/2 B) / clamping ring
Permissible ambient temperature	T3/ T4: -40 to +100 °C T5: -40 to +95 °C T6: -40 to +80 °C
Nominal length, depending on overall length	75, 85 and 125 mm

Table 3: Technical data of connection head (TR55)

Feature	Value
Sealing, sensor tip/support tube	Not pressure-proof
Design, head	JS
Enclosure, head	IP54
Material	Aluminium
Cable connection	M16x1.5

Table 4: Characteristic values for explosion protection (TR 55)

Feature	Value
Explosion protection, intrinsic safety	Ex ib IIC T6
No. of type test certificate	TÜV 10ATEX 555793 X
Maximum supply current	$I_i = 550 \text{ mA}$
Maximum supply power	$P_{\max\text{Sensor}} = 1.5 \text{ W}$
Maximum supply voltage	$V_i = 30 \text{ V}$

1.3 Scope of supply

Depending on the model, the following items are included in the scope of supply:

- Pt100 temperature sensor (different insertion lengths)
- Compression fitting G1/4 B or G1/2 B

1.4 Function

Resistance thermometers are temperature sensors that measure the change in electrical resistance of metals with changing temperature. Resistance thermometers use a very thin layer of platinum film on a ceramic substrate. The nominal resistance of these measuring elements at 0 °C is 100 Ohm.

Interpretation of readings

The nominal resistance of the Pt100 resistance thermometer at 0 °C is 100 Ohm.

Equation for calculating the resistance value at any temperature (T):

Temperature range: $T = 0 - 850 \text{ }^{\circ}\text{C}$

$$R(T) = 100 + 0.39083 \times T - 5.775 \times 10^{-5} \times T^2$$

Example calculation:

T= 80 °C Measured temperature: $T = 80 \text{ }^{\circ}\text{C}$

$$R(T) = 100 + 0.39083 \times 80 - 5.775 \times 10^{-5} \times 80^2$$

$$R(T) = 130.8968 \Omega$$

The Pt100 resistance thermometer has a resistance of approximately 130.9 Ohm at a temperature of 80 °C.

T= 20 °C Measured temperature: $T = 20 \text{ }^{\circ}\text{C}$

$$R(T) = 100 + 0.39083 \times 20 - 5.775 \times 10^{-5} \times 20^2$$

$$R(T) = 107.7935 \Omega$$

The Pt100 resistance thermometer has a resistance of approximately 107.8 Ohm at a temperature of 20 °C.

1.5 Installing the PT100 resistance thermometer in the pump

1. Remove the screw plug from the 4M.3 connection. (⇒ Section 1.6, Page 6).
2. Screw the compression fitting up to the stop.
3. Insert the Pt100 resistance thermometer into the fitting up to the stop or until the tip of the Pt100 thermometer contacts the bottom of the measurement surface.
4. Turn the connection head of the Pt100 resistance thermometer to the required position.

5. Pull the Pt100 resistance thermometer back by approximately 1 to 2 mm.
6. Tighten the compression fitting to prevent the Pt100 resistance thermometer from loosening and rotating.

1.6 Connections

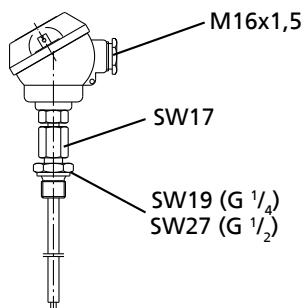


Fig. 1: Pt100 resistance thermometer (TR 55)

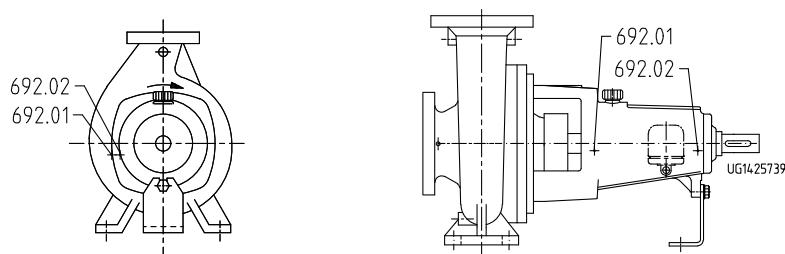


Fig. 2: Connections on MegaCPK

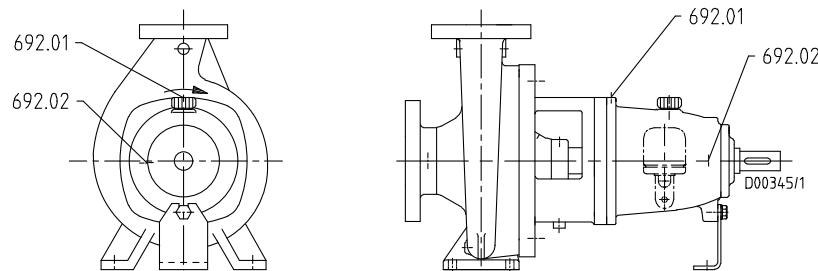


Fig. 3: Connections on CPKN, HPK: UP02/P02as bearing bracket

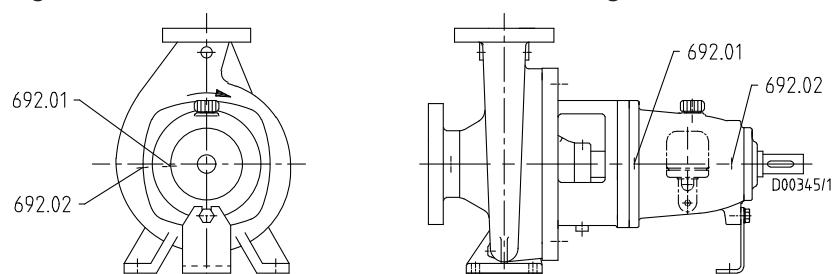


Fig. 4: Connections on CPKN, HPK: UP03-UP06/P03s-P06s bearing bracket

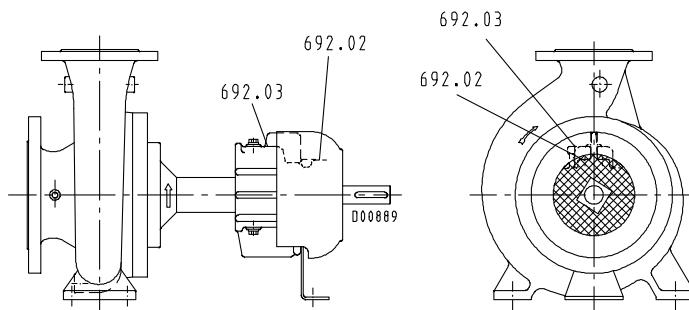


Fig. 5: Connections on HPK-L

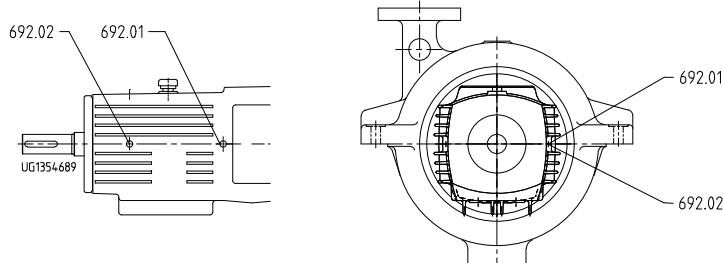


Fig. 6: Connections on RPH, RPH-HW

Table 5: Technical data, connections

Part No.	Application	Measuring point	Connection		
			CPKN MegaCPK	HPK, HPK-L	RPH, RPH-HW
692.01	Temperature measurement Pt100 resistance thermometer	Bearing, pump end	G1/4	G1/4	G1/2
692.02	Temperature measurement Pt100 resistance thermometer	Bearing, drive end	G1/4	G1/4	G1/2
692.03	Temperature measurement Pt100 resistance thermometer	Mechanical seal chamber (water temperature sensor)	G1/4	G1/4	G1/2

1.7 Electrical connection

When temperature is measured by a resistance thermometer, the measurement result is affected by the connection lead resistance.

Four-wire system A four-wire system provides the most accurate measurement because temperature and connection lead resistance effects are eliminated.

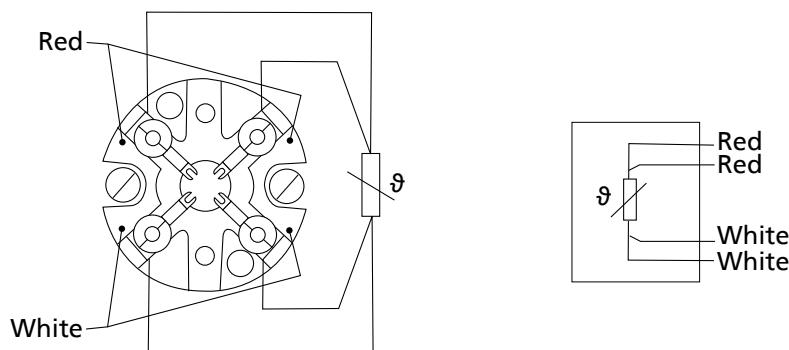


Fig. 7: Terminal assignment of four-wire system

KSB SE & Co. KGaA

Johann-Klein-Straße 9 • 67227 Frankenthal (Germany)

Tel. +49 6233 86-0

www.ksb.com